

Model SADP Portable Dewpoint Meter

The world renowned Model SADP portable dewpoint meter from Shaw Moisture Meters offers an easy to use hygrometer for fast and reliable trace moisture measurement.

Designed to operate at atmospheric pressure, the Model SADP features a large, easy to read analogue indicator scaled in °C dewpoint, °F dewpoint and corresponding parts per million (ppm(v)) range. The TR versions of the Shaw SADP offer the 0-10 ppm(v) range expanded over the full scale, which is selected by means of the rotary switch on the front panel. This allows for accurate measurement below 10 ppm(v).

The key to the Shaw automatic dewpoint meter is the unique desiccant head and sensor assembly which allows the sensor to be kept dry between tests. This ensures that the instrument is always available for rapid spot checks of moisture in gases and compressed air.

The Model SADP is fully self contained and is certified intrinsically safe for use in hazardous areas to ATEX and IECEx standards, without the need for any additional accesssories such as zener barriers etc.



The instrument is supplied ready for use with batteries installed, Calibration Certificate traceable to National & International Humidity Standards, two metres of PTFE sampling hose, instruction manual and a specially designed heavy duty leather case with shoulder strap.

Features

- Guaranteed accuracy ±3 °C to ±4 °C (±5.4 °F to ±7.2 °F) dewpoint
- Intrinsically safe to ATEX and IECEx standards
- Various ranges: overall range -100 °C to +20 °C (-148 °F to +68 °F) dewpoint
- Extended range for 0 10 ppm (TR version only)
- Analogue display, indication in °C, °F and ppm(v)
- "AutoCal" calibration feature


- Desiccant dry-down chamber for instantaneous readings
- Standard "C" type battery operation
- Self-contained, robust and reliable
- Fully portable
- Simple to operate
- Over 150 hours continuous operation
- Supplied with Calibration Certificate traceable to National & International Humidity Standards


SHAW



Desiccant Dry-Down Technology

The unique design allows purging of the gas in the "drydown position" which will bring all surfaces and voids to equilibrium. The "head" can then be raised to take a reading.

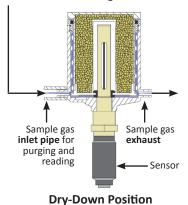

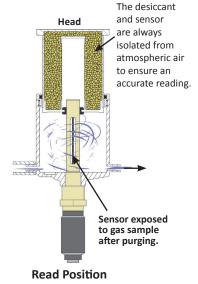

The Desiccant Head Assembly

Keeping the sensor dry between tests ensures that the SADP is always ready to carry out rapid spot checks. The unique design of the *desiccant head* achieves this by surrounding the sensor with desiccant before the head is lifted for sampling.

At no time is the sensor allowed to come into contact with ambient air. The chamber is also designed so that the void space and chamber wall surfaces are purged with sample gas, prior to exposure of the sensor, giving faster, more accurate and reliable results.

Automatic Calibration

The most important and unique feature of the Shaw system is the **automatic calibration** facility. Each Shaw sensor is precisely manufactured to saturate with water vapour at its design maximum. Hence, when the sensor is exposed to moisture above its maximum operating range, it will rapidly come into equilibrium and cease to respond to any further increase in moisture. This forms the basis of automatic calibration (AutoCal).

The Shaw sensor can be checked by simply exposing it to any atmosphere which is wetter than the operating range of the sensor (usually room air is sufficient) and adjusting the calibration control on the front panel of the instrument. The sensor is now set up with the instrument and ready for use.

AutoCal can be carried out in-situ and without the need for any special equipment or skilled personnel. The net result is reduced downtime, minimal calibration costs and immediate verification of the system.



SADP complete with two metres of PTFE sampling hose, pressure calculator, instruction manual and heavy duty leather case with shoulder strap.



Specifications

DEWPOINT SENSOR

Sensing Element

Shaw Ultra High Capacitance Aluminium Oxide Sensor

Ranges

P (Purple): -100 to 0 °C dewpoint, 0 - 6,000 ppm(v)

S (Silver): -100 to -20 °C dewpoint, 0 - 1,000 ppm(v)

G (Grey): -80 to 0 °C dewpoint, 0 - 6,000 ppm(v)

R (Red): -80 to -20 °C dewpoint, 0 - 1,000 ppm(v)

B (Blue): -80 to +20 °C dewpoint, 0 - 23,000 ppm(v)

• Intrinsic Safety Certification

ATEX: Ex II 1 G Ex ia IIC T6 Ga

IECEx: Ex ia IIC T6 Ga

 ϵ

AutoCal

Field calibration/span check facility. Activated and operated via potentiometer on the front of the instrument

• Factory Calibration

Supplied with Certificate of Calibration traceable to National Physical Laboratory (NPL)

Accuracy

 \pm 3 °C/ \pm 4 °C (\pm 5.4 °F/ \pm 7.2 °F) dewpoint NPL traceable -90 °C to +20 °C (-130 °F to +68 °F)

Response Times

Wet to dry: -20 °C to -60 °C - less than 120 secs Dry to wet: -100 °C to -20 °C - less than 20 secs

Sample Flow Rate

Flow independent but ideally 2 to 5 litres per minute Max: 20 litres/min

Calibration Warranty

12 months from date of dispatch

ELECTRICAL

Electromagnetic Compatibility (EMC)

Immunity: complies with EN 61000-6-1:2001 Emissions: complies with EN 61000-6-3:2000

Warm Up Time

5 seconds

Display

Analogue: 120 mm Taut Band indicating meter showing dewpoint and ppm with amplified range of 0 - 10 ppm on TR versions.

Power Supply

9 V DC – six "C" type batteries (included)

Battery Life

In excess of 150 hours continuous operation

Resolution

0.1 °C, 0.2 °F dewpoint or 0.1 ppm(v)

Repeatability

Better than ±0.5 °C (±0.9 °F) dewpoint

MECHANICAL

• Dimensions and Weight

Overall dimensions: 200 mm (w) x 225 mm (d) x 278 mm (h) Height (328 mm with head extended) Weight 4.5 kg

• Operating Pressure

Atmospheric to 0.3 barg

• Operating Humidity (External)

Maximum - 95% RH non-condensing

Operating Temperature Storage Temperature

-20 °C to +40 °C (-4 °F to +104 °F) -20 °C to +40 °C (-4 °F to +104 °F)

Sensor Protection

316 sintered stainless steel filter - 50 micron

• Weatherproof Classification

IP66/NEMA 4X


Connections

Two Fir Tree type on either side of desiccant chamber

Mechanical Warranty

24 months in case of faulty workmanship and defective parts

Guide to Installation

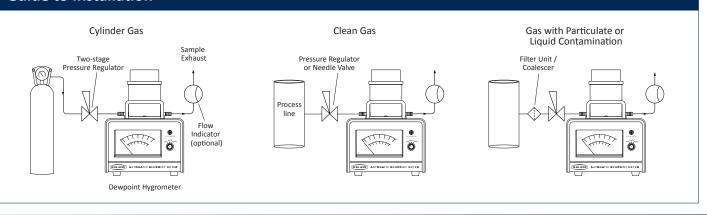



Ordering Information

Model SADP

SADP - (R)

$C \in \langle \epsilon_x \rangle$




(R) - Choose required range:


-100 to 0 °C dewpoint P (Purple): 0 - 6,000 ppm(v) -100 to -20 °C dewpoint 0 - 1,000 ppm(v) **S** (Silver): -80 to 0 °C dewpoint 0 - 6,000 ppm(v) G (Grey): -80 to -20 °C dewpoint R (Red): 0 - 1,000 ppm(v) B (Blue): -80 to +20 °C dewpoint 0 - 23,000 ppm(v) TR-G (TR - GREY): -80 to 0 °C dewpoint 0 - 6,000 & 0 - 10 ppm(v) TR-R (TR - RED): -80 to -20 °C dewpoint 0 - 1,000 & 0 - 10 ppm(v)

Example:

To order a Model SADP with a measuring range of -80 to 0 °C dewpoint (grey sensor) please order as SADP-G

SADP General Assembly Diagram

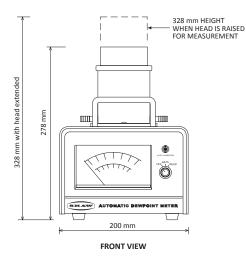

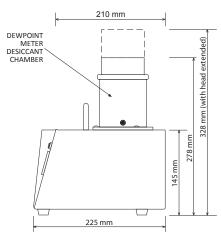

SIDE VIEW

Related Products

SU3 Sample Plate for mounting on the side of the SADP, comprising flow meter, filter unit and pressure regulator (210 bar).



SU2 Sample Plate for mounting on top of the SADP, comprising flow meter and pressure regulator (210 bar).



Pressure Regulator

Pressure regulators (Model PRV) are used for accurate control of pressure at all important points in a sample system.



Flow Meter

This compact flow meter (Model FLMET) is used to provide a visual indication and fine control of sample flow.



Service Kit

Includes desiccant, head seal kit, grommet, silicone grease and batteries.

Includes as standard:

Sensor, batteries installed, Calibration Certificate, two metres PTFE sampling hose, instruction manual, leather case/fabric case, pressure calculator, screw driver and Allen key.

New England - ETA Process Instrumentation 119 Foster Street, Bldg #6

Peabody, MA 01960 Tel: (978) 532-1330 www.etapii.com sales@etapii.com

Upstate NY - Martech Controls 2000 Teall Avenue Syracuse, NY13026

Tel: (315) 876-9120 www.martechcontrols.com sales@martechcontrols.com